

INSTALLATION INSTRUCTION

Ocularc 7030-CS LED Track Luminaires

H/L/J-7030-CS



WARNING

IMPORTANT: NEVER attempt any work without shutting off the electricity.

- Read all instructions before installing.
- System is intended for installation by a qualified electrician in accordance with the National Electrical Code and local regulations.
- Go to the main fuse box, or circuit breaker. Place the main power switch in the "OFF" position and unscrew the fuse(s) or switch "OFF" the circuit breaker switch(es) that control the power to the fixture or room that you are working on.
- Place the wall switch in the "OFF" position.

AVERTISSEMENT


IMPORTANT: Coupez l'électricité avant TOUTE manipulation.

- Lisez toutes les instructions avant d'installer.
- Système est destiné à être installé par un électricien qualifié en conformité avec le code national de l'électricité et les règlements locaux.
- Accédez au panneau central de disjoncteurs ou de fusibles de votre demeure et placez l'interrupteur principal en position d'arrêt (« OFF »).
- Placez l'interrupteur mural en position d'arrêt (« OFF »).

OVERVIEW:

Fixtures are designed for use on WAC Lighting's track systems.

LED TRACK LUMINAIRE	TRACK SYSTEM
H-7030 Series	120V H Track
L-7030 Series	120V L Track
J-7030 Series	120V J or J2 Track

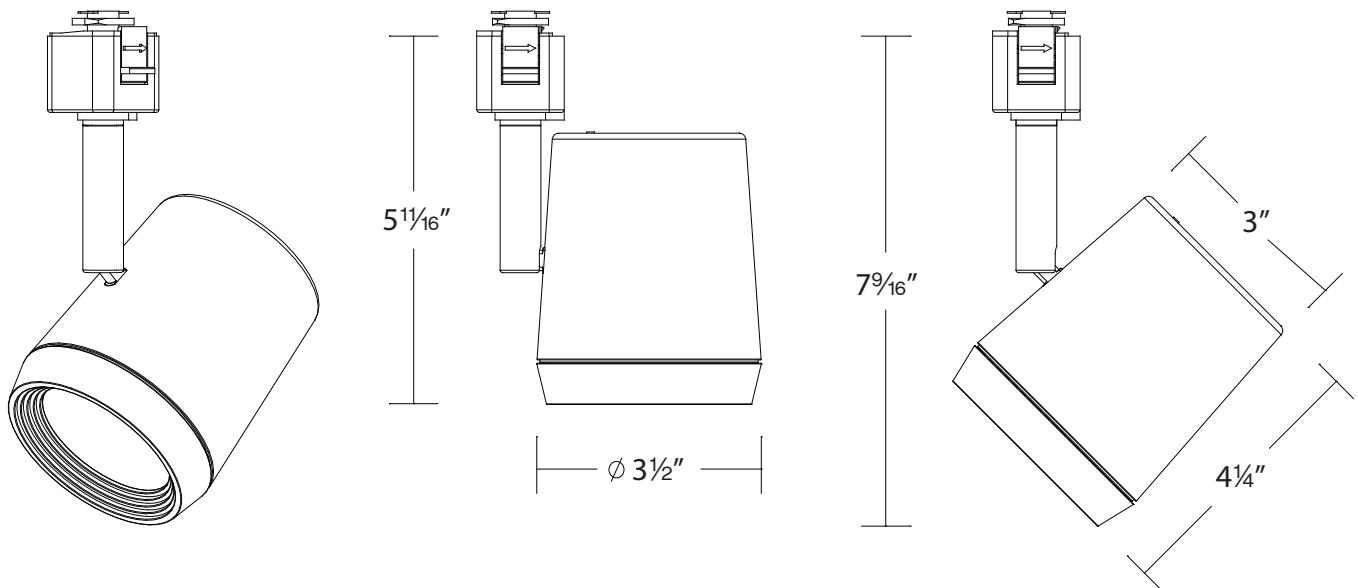

NOTE: All parts must be used as indicated in these instructions. Do not substitute any parts, leave parts out, or use any parts that are worn out or broken. Failure to follow this instruction could invalidate the ETL/cETL listing of this fixture.

wacighting.com

Phone (800) 526.2588

Fax (800) 526.2585

Headquarters, East Manufacturing Facility

44 Harbor Park Drive

Port Washington, NY 11050

South East Manufacturing Facility

1600 Distribution Ct

Lithia Springs, GA 30122

Central Manufacturing Facility

1700 South J Elmer Freeway, Ste 100

Cedar Hill, TX 75104

West Manufacturing Facility

1750 S Archibald Ave

Ontario, CA 91761

INSTALLATION INSTRUCTION

Ocularc 7030-CS LED Track Luminaires

H/L/J-7030-CS

WAC


CCT SELECTION:

1. The fixture features an on-board CCT selection switch.
2. Prior to powering the fixture, use the slider switch to select the desired fixture CCT (see **FIG.1**)

FIXTURE INSTALLATION FOR H/L/J TRACK:

1. The track has a groove running its length to indicate polarity and the track adapter locking tab has an arrow indicating locking direction.
2. Insert the adapter into track slot (see **FIG.1**).
For H/J Track: The arrow should be on the grooved side of the track.
For L Track: The arrow should be on the side opposite the grooved side of the track.
3. Push up to rotate the adapter into the lock position.
4. Reverse the procedure to remove. The fixture may be positioned anywhere along the track.


FIG.1

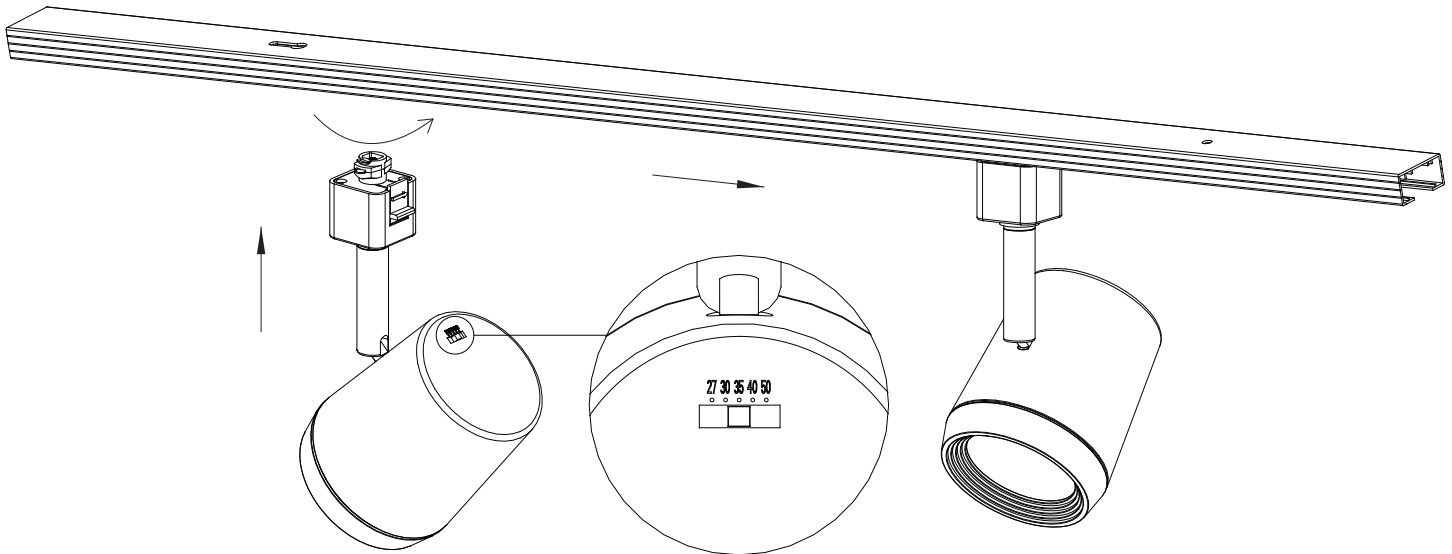

FIXTURE POSITIONING:

Power ON the fixture, and rotate the luminaire's body horizontally or vertically to aim it properly. The fixture can rotate $\pm 90^\circ$ vertically and 350° horizontally (see **FIG.2**).

FIG.2

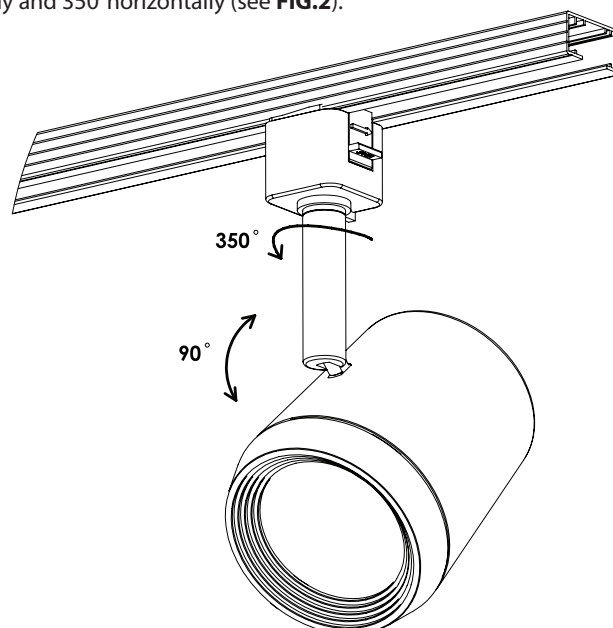

wacighting.com

Phone (800) 526.2588

Fax (800) 526.2585

Headquarters, East Manufacturing Facility

44 Harbor Park Drive

Port Washington, NY 11050

South East Manufacturing Facility

1600 Distribution Ct

Lithia Springs, GA 30122

Central Manufacturing Facility

1700 South J Elmer Freeway, Ste 100

Cedar Hill, TX 75104

West Manufacturing Facility

1750 S Archibald Ave

Ontario, CA 91761

INSTALLATION INSTRUCTION

Ocularc 7030-CS LED Track Luminaires

H/L/J-7030-CS

WAC

OPTIC REPLACEMENT (FOR BEAM SELECTION):

1. With the fixture powered OFF, remove fixture from the track and place on a flat surface with the baffled front cover facing the ceiling.
2. Rotate the baffled front cover counter clockwise (CCW) and lift to remove it from the fixture (see **FIG.3**).
3. Lift the clear glass in order to install the film.
CAUTION: The clear glass may get damaged if dropped. Take care to remove the clear glass on a level surface.
4. For beam selection, choose the appropriate film (NARROW FLOOD or FLOOD) or remove the film for the SPOT beam.
NOTE: The fixture is supplied with the TIR lens, clear glass, and FLOOD film pre-installed.
The TIR lens and clear glass are required for all standard beam configurations.
5. Apply the appropriate film (if selected) within the lip of the optic holder, between it and the clear glass (see **FIG.4**).
NOTE: Ensure that any films installed, are installed with the GLOSS SIDE OUT.
6. Lay the clear glass in the optic holder and re-install the baffled front cover.

FIG.3


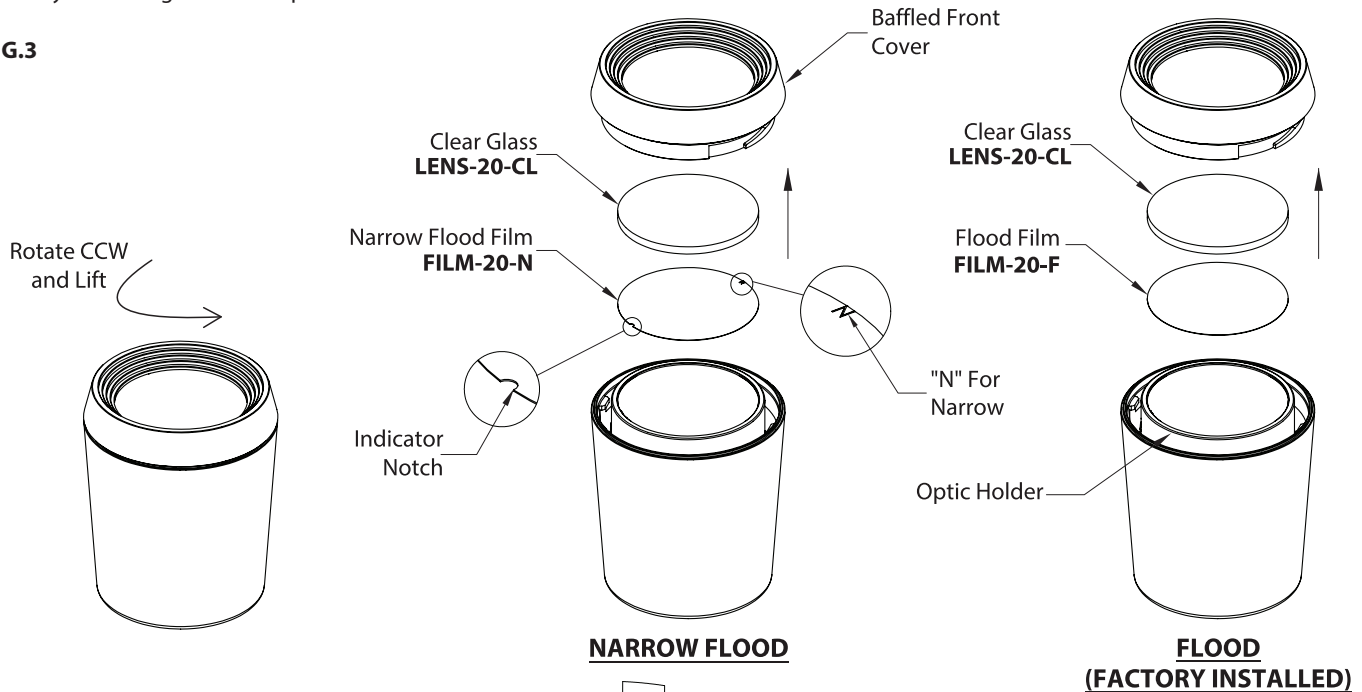


FIG.4

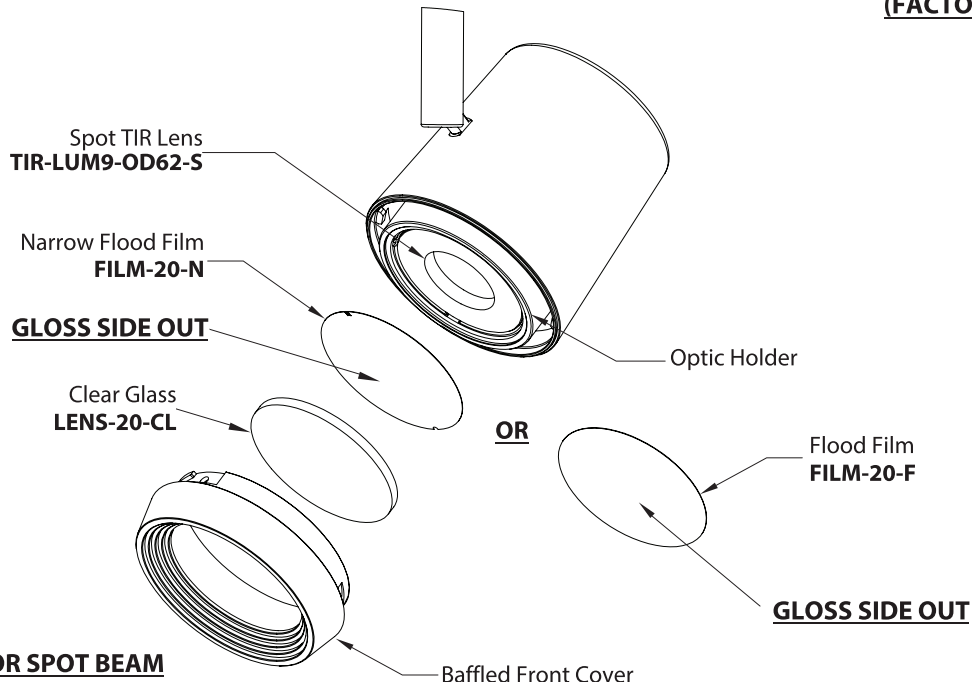

* REMOVE FILM FOR SPOT BEAM

wacighting.com
Phone (800) 526.2588
Fax (800) 526.2585

Headquarters, East Manufacturing Facility
44 Harbor Park Drive
Port Washington, NY 11050

South East Manufacturing Facility
1600 Distribution Ct
Lithia Springs, GA 30122

Central Manufacturing Facility
1700 South J Elmer Freeway, Ste 100
Cedar Hill, TX 75104

West Manufacturing Facility
1750 S Archibald Ave
Ontario, CA 91761

INSTALLATION INSTRUCTION

Ocularc 7030-CS LED Track Luminaires


H/L/J-7030-CS

WAC

OPTIONAL ACCESSORIES:

1. The fixture accommodates one lens OR one glare control accessory. Refer to the spec sheet for the list of compatible accessories.
2. With the fixture powered OFF, remove the fixture from the track and place on a flat surface with the baffled front cover facing the ceiling.
3. Ensure the appropriate beam angle is selected (see previous section). Remove the clear glass before installing the accessory.
CAUTION: The clear glass may get damaged if dropped. Take care to remove the clear glass on a level surface.
4. Install the desired LENS-20 accessory between the installed film (or optic holder for SPOT) and baffled front cover (see **FIG.5**).
NOTE: Accessory lenses MUST be installed IN PLACE of the existing clear lens.
5. Re-install the baffled front cover.

FIG.5

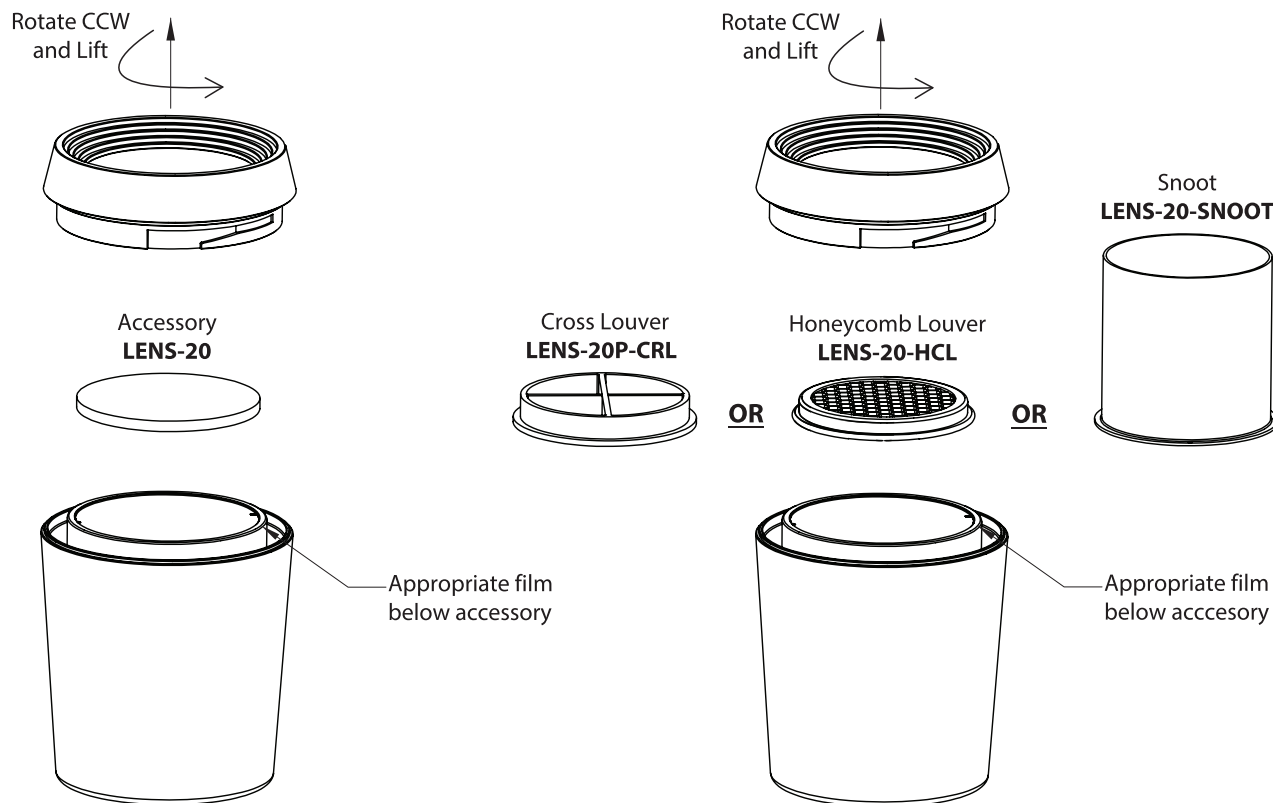

wacighting.com

Phone (800) 526.2588

Fax (800) 526.2585

Headquarters, East Manufacturing Facility

44 Harbor Park Drive

Port Washington, NY 11050

South East Manufacturing Facility

1600 Distribution Ct

Lithia Springs, GA 30122

Central Manufacturing Facility

1700 South J Elmer Freeway, Ste 100

Cedar Hill, TX 75104

West Manufacturing Facility

1750 S Archibald Ave

Ontario, CA 91761