


SAFETY CABLE

DISCONNECT POWER BEFORE RELAMPING OR WIRING THE FIXTURE READ ALL INSTRUCTIONS COMPLETELY BEFORE STARTING INSTALLATION.

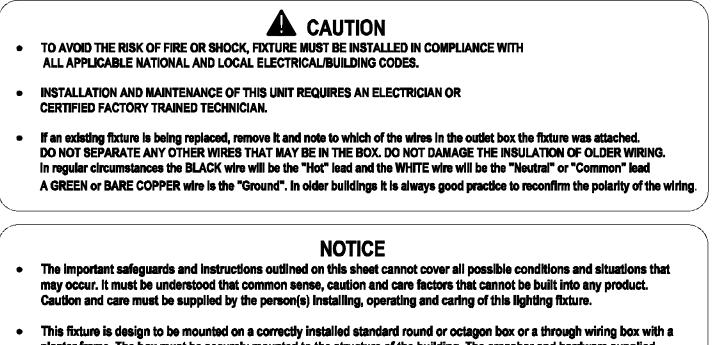


This fixture is design to be mounted on a correctly installed standard round or octagon box or a through wiring box with a plaster frame. The box must be securely mounted to the structure of the building. The crossbar and hardware supplied should be used. Directly mounting the fixture to the outlet box may make it impossible to correctly align the fixture.

FIXTURE PREPARATION

1. Remove the fixture, shades, crystals and parts bag(s) from the carton. STRUCTURE OR BRACE

NOTICE: Before discarding the carton, CABLE CLAMP JUNTION BOX double check to make certain that all parts are found. \///// MOUNTING SCREW CROSSBAR FIXTURE INSTALLATION GREEN SCREW 1. Attach the crossbar to the outlet box. NIPPLE (The green screw should face the floor) HEX NUT 2. Thread the hex nut onto the nipple and the nipple into the Canopy crossbar. Place the canopy over the nipple and against the ceiling. Adjust the nipple so that $\frac{1}{4}$ of threads extend beyond the canopy. Tighten the hex nut against the crossbar. Using the cap nut, install the canopy. WARNING Loop The use of chain pliers for opening and closing links of chain is required. The use of tools other Cap nut than chain pliers may damage the chain link resulting in a failure which can cause harm to the fixture, property, and/or person(s). Chain

- 3. Open the end links of the chains, then attach these chains to the canopy loops. Hang the fixture on the chains and adjust to the desire height. Remove excess chain. Close all chain links.
- 4. Thread the lead wires and ground wire up through alternating links of the chain until the ceiling is reached.
- 5. Measure 8" of lead and ground wire beyond the top of the chain. Cut off the excess wire. Strip the insulation off the ends of the leads exposing approx. ¹/₂" of wire. Twist the strands of wire together. Push the leads and ground wire through the loop and into the canopy.
- 6. Fasten the ground wire to the green or bare copper wire in the outlet box or the green screw on the crossbar.

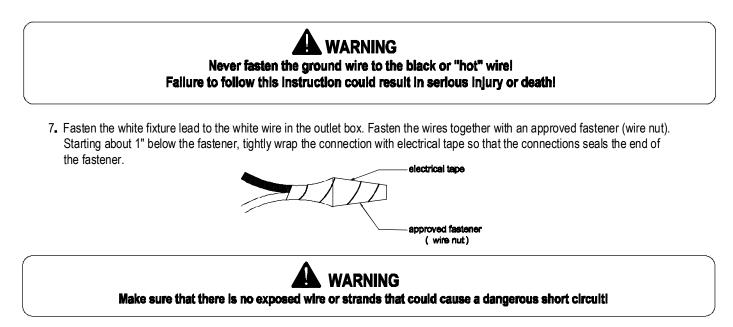


- 8. Connect the black smooth fixture lead to the black wire in the outlet box. Fasten the joined wires as in step 7.
- 9. Using the cap nut, loosely fasten the fixture to the outlet box. Adjust the orientation of the fixture and tighten the cap nut to secure the canopy to the ceiling.
- 10. Fasten the suspension rod to the junction body. Hang the decorative net to the suspension rods.
- 11. Install the labeled crystals to the designated chains. Remove tag once through. Attach decorative chain to the suspension rods.

NOTICE: If the fixture is being installed in a room with a hard floor (tile, wood, etc.), place a blanket or carpet below the fixture before installing the crystals.


12. Install the lamps (G9 light bulbs). NOTE: This fixture is rated for 50 watt G9 lamp.



13. Restore power to circuit at breaker or fuse box.

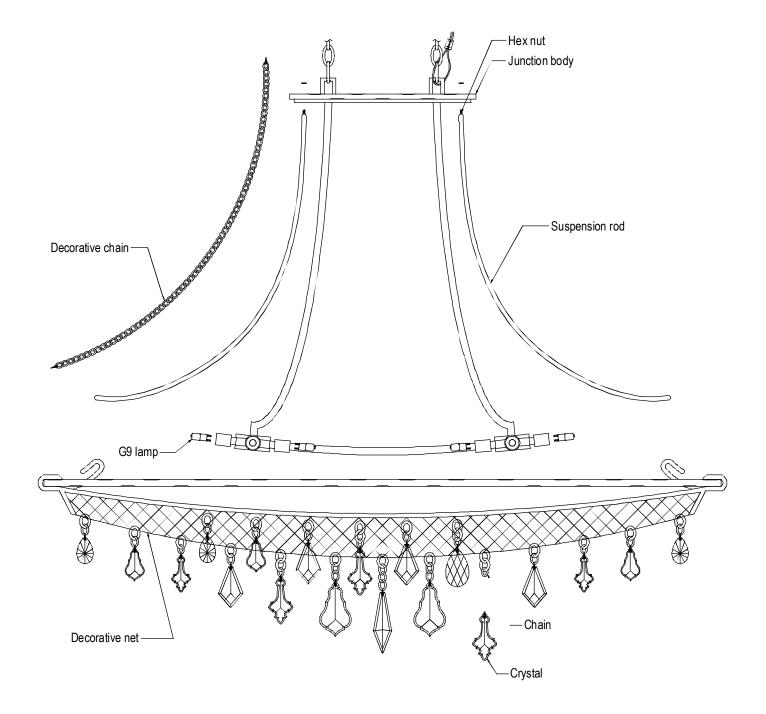

CRYSTAL SCHEDULE

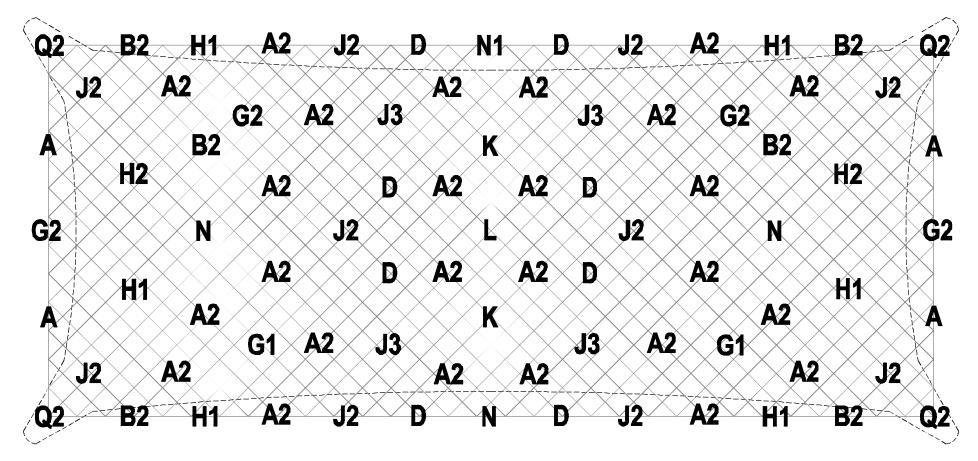

83 PCS.

| A | A2 | B 2 | D | G1 | G2 | H1 | H2 | J2 | J3 | K | L | N | N1 | Q2 |
|--------|---------|------------|--------|--------|--------|--------|--------|---------|--------|--------|-------|--------|-------|--------|
| | | | | ß | Ş | | | | | | | | | |
| 4 PCS. | 26 PCS. | 6 PCS. | 8 PCS. | 2 PCS. | 4 PCS. | 6 PCS. | 2 PCS. | 10 PCS. | 4 PCS. | 2 PCS. | 1 PC. | 3 PCS. | 1 PC. | 4 PCS. |